


PLACA GUÍA DE ACERO (STEEL WEAR PLATE)

5130

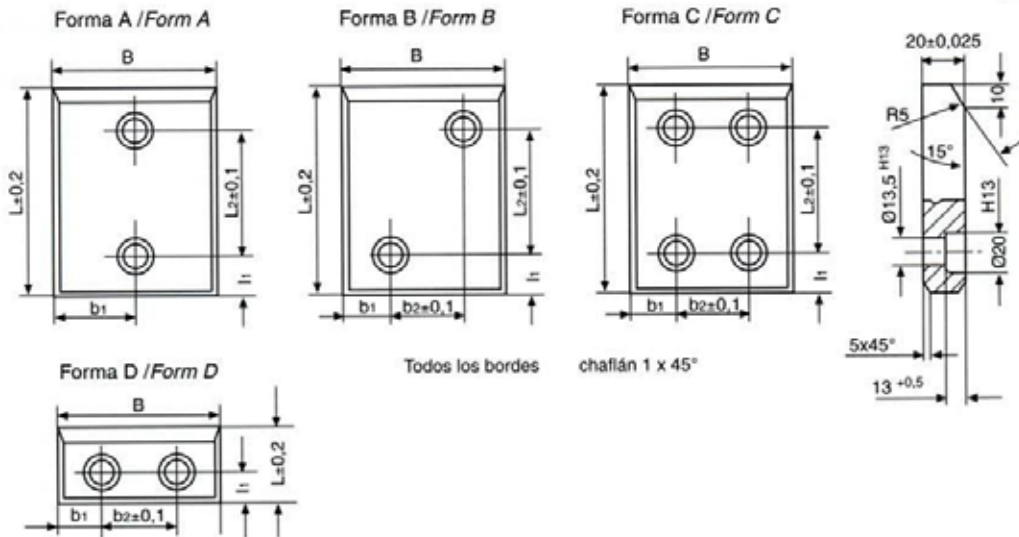

| Ref. Nº. | Anchura Width B | Longitud Length L ± 0,2 | Forma Form | l ₁ | l ₂ ± 0,1 | b ₁ | b ₂ ± 0,1 | |
|-----------|-----------------|-------------------------|------------|----------------|----------------------|----------------|----------------------|-----|
| 5130 - 1 | 50 | 80 | A | 20 | 35 | 25 | - | |
| 5130 - 2 | | 100 | | | 55 | | | |
| 5130 - 3 | | 125 | | | 80 | | | |
| 5130 - 4 | | 160 | | | 115 | | | |
| 5130 - 5 | | 200 | | | 155 | | | |
| 5130 - 6 | 80 | 100 | B | 20 | 55 | 20 | 40 | |
| 5130 - 7 | | 125 | 80 | | | | | |
| 5130 - 8 | | 160 | C | | 115 | | | |
| 5130 - 9 | | 200 | 155 | | | | | |
| 5130 - 10 | 100 | 50 | D | 25 | - | 20 | 60 | |
| 5130 - 11 | | 80 | B | 20 | 35 | | | |
| 5130 - 12 | | 100 | | | 55 | | | |
| 5130 - 13 | | 125 | C | 20 | 80 | | | |
| 5130 - 14 | | 160 | | | 115 | | | |
| 5130 - 15 | 200 | 155 | | | | | | |
| 5130 - 16 | 125 | 80 | B | 20 | 35 | 20 | 85 | |
| 5130 - 17 | | 100 | 55 | | | | | |
| 5130 - 18 | | 125 | C | | 20 | | | 80 |
| 5130 - 19 | | 160 | | | | | | 115 |
| 5130 - 20 | | 200 | | | | | | 155 |
| 5130 - 21 | 160 | 100 | C | 20 | 55 | 20 | 120 | |
| 5130 - 22 | | 125 | | | 80 | | | |
| 5130 - 23 | | 160 | | | 115 | | | |

MATERIAL: Acero de cementación
DUREZA: 62 ± 2 HRc
PROFUNDIDAD DE CEMENTACIÓN: 0,8 - 1,2 mm.
FORMA DE PEDIDO: 5130 - B x L

MATERIAL: Hardened Steel
HARDNESS: 62 ± 2HRc
HARDENED DEEP: 0.8 - 1.2 mm.
HOW TO ORDER: 5130 - B x L